

RAPORT ISTORIC SERVICE AUTO COMPLET | 100% DETALIAT | DIRECT DIN REPREZENTANTA



Cover - Digital Service Report (History)

This report contains the following acknowledgements



Overview 7	04.02.2016
Overview 6	16.03.2015
Overview 5	25.06.2014
Overview 4	22.10.2013
Overview 3	24.04.2013
Overview 2	26.09.2012
Overview 1	08.03.2012

Service history has been printed by



smart

Service station signature/stamp

Digital Service Report (History)

Vehicle data	
Vehicle	E [] IC
First registration	20.06.2011
FIN	WD [] 202

Next 02.2017 **Next test technical** 06.2016

Service 157130 km
 (For the next review please note the additional information about the vehicle (service book and Assist system indications))

Current Service Report

Mercedes-Benz Mercedes-Benz [] zawa Sp. with Date 04.02.2016
 o.o. []
 ul. G []
 Wars []
 Repair Order No. 16 [] 1
 Run 137130 km

Serviced Service

Service A
 Workshop code GD0V
 Time Remaining 40 Days
 Remaining mileage -1700 km

Additional work

Filter Replacement
 (cabin)
 Air filter cartridge replacement
 Automatic transmission:
 oil and filter exchange
 Service A
 Engine: filter and oil replacement
 motor
 Brake fluid replacement

Oil quality/viscosity

Description Engine oil
 Viscosity 5W-30
 ' 229.51
 Description Automatic transmission
 Viscosity
 ' 236.15

For next review

Mercedes-Benz
 No corrosion guarantee
 perforation

Interval compatible with guidelines of Mercedes-Benz AG

Complies with

Additional activities performed in accordance with the Mercedes-Benz AG guidelines

Completed

Service Report 6

Mercedes-Benz

 Mercedes-Benz
 z o.o.
 ul. G
 Warszawa Sp.

Date 16.03.2015

Repair Order No. 61 9

Run 115396 km

Serviced

Service	Service B
Workshop code	860E
Time Remaining	100 Days
Remaining mileage	-100 km

Oil quality/viscosity

Description	Engine oil
Viscosity	0W-30
'	229.51

Additional work

Replacement of front axle brake pads	<input checked="" type="checkbox"/>
Replacement of rear axle brake pads	<input checked="" type="checkbox"/>
Filter Replacement (cabin)	<input checked="" type="checkbox"/>
Air filter cartridge replacement	<input checked="" type="checkbox"/>
Engine: replacement of filter and engine oil	<input checked="" type="checkbox"/>

For next review

Mercedes-Benz	<input checked="" type="checkbox"/>
Warranty for no perforation corrosion	<input checked="" type="checkbox"/>

Interval according to Mercedes-Benz AG guidelines

Complies with	<input checked="" type="checkbox"/>
---------------	-------------------------------------

Additional operations carried out in accordance with the guidelines of Mercedes-Benz AG	<input checked="" type="checkbox"/>
---	-------------------------------------

Completed



istoric-service.ro

istoric-service.ro



Service Report 5

Mercedes-Benz Mercedes-Benz Sp. z o.o. Date 25.06.2014
 ul. G Warszawa Repair Order No. 51 3
 Run 95245 km

Serviced

Service Service A
 Workshop code 505
 120
 Time Remaining Days
 Remaining mileage 1800 km
Oil quality/viscosity
 Description Engine oil
 Viscosity 5W-30

Additional work

Filter Replacement (cabin)
 Air filter cartridge replacement
 Engine: replacement of filter and engine oil

For next review

Mercedes-Benz No corrosion guarantee perforation

Interval compatible with guidelines of Mercedes-Benz AG

Complies with

Additional activities performed in accordance with the Mercedes-Benz AG guidelines

Completed

Service Report 4

Mercedes-Benz Mercedes-Benz Sp. z o.o. Date 22.10.2013
 ul. G Warszawa Repair Order No. 41 80
 Run 77028 km

Serviced

Service Service B
 Workshop code 5E0K
 Time Remaining 185 Days
 Remaining mileage 2000 km
Oil quality/viscosity
 Description Engine oil
 Viscosity 5W-30
 ' 229.51

Additional work

Air filter cartridge replacement
 Fuel filter replacement
 Engine: filter and oil replacement motor
 Brake fluid replacement

For next review

Mercedes-Benz No corrosion guarantee perforation

Interval compatible with guidelines of Mercedes-Benz AG

Complies with

Additional activities performed in accordance with the Mercedes-Benz AG guidelines

Completed

Service Report 3

Mercedes-Benz Zbigniew [redacted] wakovsky Date 24.04.2013
 ul. Eu ul. Eu Repair Order No. 35 [redacted]
 Wars Wars Run 58979 km

Serviced

Service Service A
 Workshop code 850D
 Time Remaining 155 Days
 Remaining mileage 100 km

Oil quality/viscosity

Description Engine oil
 Viscosity MB
 ' 229.51

Additional work

Brake lining replacement
 front axle
 Brake lining replacement
 rear axle
 Air filter cartridge replacement
 Engine: filter and oil replacement
 motor

For next review

Mercedes-Benz
 No corrosion guarantee
 perforation

Interval compatible with guidelines of Mercedes-Benz AG

Complies with

Additional activities performed in accordance with the Mercedes-Benz AG guidelines

Completed

Service Report 2

Mercedes-Benz Mercedes [redacted] szawa Sp. with Date 26.09.2012
 ul. Go ul. Go Repair Order No. 31 [redacted] 8
 Warsaw Warsaw Run 39053 km

Serviced

Service Service B
 Workshop code 606
 Time Remaining 165 Days
 Remaining mileage 1200 km

Oil quality/viscosity

Description Engine oil
 Viscosity MB
 ' 229.51

Additional work

Air filter cartridge replacement
 Engine: filter and oil replacement
 motor

For next review

Mercedes-Benz
 No corrosion guarantee
 perforation

Interval compatible with guidelines of Mercedes-Benz AG

Complies with

Additional activities performed in accordance with the Mercedes-Benz AG guidelines

Completed

Service Report 1

Mercedes-Benz Mercedes-Benz szawa Sp. Date 08.03.2012
 z o.o. ul. G Repair Order No. 316 8
 Wars Run 20284 km

Serviced

Service Service A
 Workshop code 505
 Time Remaining 120 Days
 Remaining mileage 0 km

Oil quality/viscosity

Description Engine oil
 Viscosity ' 229.51

Additional work

Air filter cartridge replacement
 Engine: replacement of filter and engine oil

For next review


Mercedes-Benz
 Warranty for no perforation corrosion


Interval according to Mercedes-Benz AG guidelines

Complies with

Additional operations carried out in accordance with the guidelines of Mercedes-Benz AG

Completed

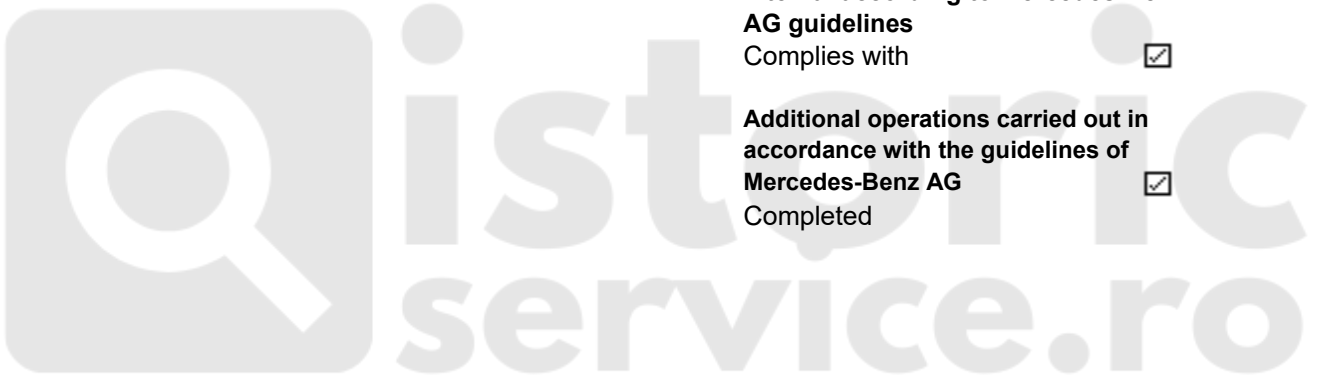

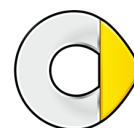

smart

Vehicle information (History of damage)

FIN: WDD [redacted] 202

Current vehicle guidelines:

none

Open service actions:

Code damaged a	Description	Date terminated a	Status shares	KDM-Type	Days to terminated a
5497507	20P5497507		Active	Recall	0





















Decisions of ESKULAB:

History of damage:

Type	Date acc.	X	#	Code damaged a	Corruption code description	Application No	Code country du	Market	LL	M	E	Note No. Un.	Note date Un.
	04.02.2011 6				Small service - Regular reviews	1	559		137130	km			
	16.03.2011 5				Large service - Regular reviews	6	559		115396	km			
	13.03.2011 5	AA	35	000011SV 7	Large scope of review/ Review B Agreement service	4	559		115396	km	0	00000000 0	03.04.2015
	13.03.2011 5	AB	34	009102SV 7	Air filter cartridge Service Contract	4	559		115396	km	0	00000000 0	03.04.2015
	13.03.2011 5	AC	33	083108SV 7	Air Filter/Filter antipollen system heating/ventilation Service Contract	4	559		115396	km	0	00000000 0	03.04.2015
	13.03.2011 5		32	082A2353 7	Windscreen wiper blade front left Not sufficient performance	4	559		115396	km	0	00000000 0	03.04.2015
	13.03.2011 5		31	082063SV 7	Wiper blade at the back Service Contract	4	559		115396	km	0	00000000 0	03.04.2015
	13.03.2011 5		30	042101D1 7	Brake disk with front Consumption	4	559		115396	km	0	00000000 0	03.04.2015
	13.03.2011 5		29	042201D1 7	Rear brake disk Consumption	4	559		115396	km	0	00000000 0	03.04.2015
	25.06.2011 4				Small service - Regular reviews	8	559		95245	km			
	24.06.2011 4	AD	28	000012SV 7	Small scope of review/ review A Agreement service	4	559		95245	km	0	00000000 0	27.06.2014
	24.06.2011 4	AB	27	009102SV 7	Air filter cartridge Service Contract	4	559		95245	km	0	00000000 0	27.06.2014
	24.06.2011 4	AC	26	083108SV 7	Air Filter/Filter antipollen system heating/ventilation Service Contract	4	559		95245	km	0	00000000 0	27.06.2014
	24.06.2011 4		25	043051367	Vacuum pump Noise	4	559		95245	km	0	00000000 0	27.06.2014
	22.10.2011 3	AA	24	000011SV 7	Large scope of review/ Review B Agreement service	4	559		77028	km	0	00000000 0	25.10.2013





Vehicle information (History of damage)

08301

Type	Date acc.	X	#	Code damaged a	Corruption code description	Application No	Code country du	Market	LL	M	E	Note No. Un.	Note date Un.
	22.10.2011 3	AB	23	009102SV 7	Air filter cartridge Service Contract	4	559		77028	km	0	00000000 0	25.10.2013
	22.10.2011 3		22	047028SV 7	Water separator in fuel system Service Contract	4	559		77028	km	0	00000000 0	25.10.2013
	22.10.2011 3		21	043000SV 7	fluid replacement Contract service	4	559		77028	km	0	00000000 0	25.10.2013
	22.10.2011 3	AC	20	083108SV 7	Air Filter/Filter antipollen system heating/ventilation Service Contract	4	559		77028	km	0	00000000 0	25.10.2013
	22.10.2011 3	AE	19	007921427		4	559		77028	km	0	00000000 0	25.10.2013
	22.10.2011 3		18	054687908	Control Module Parktronic Version software	4	559		77028	km	0	00000000 0	25.10.2013
	22.10.2011 3				Large service - Regular reviews	4	559		77028	km			
	24.04.2011 3	AD	17	000012SV 7	Small scope of review/ review A Agreement service	3	559		58979	km	0	00000000 0	26.04.2013
	24.04.2011 3	AB	16	009102SV 7	Air filter cartridge Service Contract	3	559		58979	km	0	00000000 0	26.04.2013
	24.04.2011 3		15	077300SV 8	Cleaning/ window lubrication roofing service	3	559		58979	km	0	00000000 0	26.04.2013
	24.04.2011 3		14	042114D1 7	Brake lining with front Consumption	3	559		58979	km	0	00000000 0	26.04.2013
	24.04.2011 3		13	042214D1 7	Brake lining at the rear Consumption	3	559		58979	km	0	00000000 0	26.04.2013
	24.04.2011 3		12	08204X01 8	Data update system maps Navigation additional	3	559		58979	km	0	00000000 0	26.04.2013
	24.04.2011 3				Small service - Regular reviews	3	559		58979	km			
	17.12.2011 2		11	050207387	Flexible band fluid cooling loosening	3	559		46388	km	0	00000000 0	04.01.2013
	17.12.2011 2		10	059902368		3	559		46388	km	0	00000000 0	04.01.2013
	26.09.2011 2	AF	9	001215047	connection port cylinder head leak	3	559		39053	km	0	00000000 0	28.09.2012
	26.09.2011 2	AF	8	001215M3 8	connection port cylinder head Receive and deliver repaired vehicle	3	559		39053	km	0	00000000 0	28.09.2012
	26.09.2011 2	AA	7	000011SV 7	Large scope of review/ Review B Agreement service	4	559		39053	km	0	00000000 0	29.03.2013
	26.09.2011 2	AB	6	009102SV 7	Air filter cartridge Service Contract	4	559		39053	km	0	00000000 0	29.03.2013
	26.09.2011 2	AC	5	083108SV 7	Air Filter/Filter antipollen system heating/ventilation Service Contract	4	559		39053	km	0	00000000 0	29.03.2013
	26.09.2011 2				Large service - Regular reviews	3	559		39053	km			
	08.03.2011 2	AE	4	007921257		3	559		20284	km	0	00000000 0	16.03.2012

Vehicle information (History of damage)

08301

Type	Date acc.	X	#	Code damaged a	Corruption code description	Application No	Code country du	Market	LL	M	E	Note No. Un.	Note date Un.
	08.03.2011 2	AA	3	000011SV 7	Large scope of review/ Review B Agreement service	4	559		20284	km	0	00000000 0	29.03.2013
	08.03.2011 2	AB	2	009102SV 7	Air filter cartridge Service Contract	4	559		20284	km	0	00000000 0	29.03.2013
	08.03.2011 2	AC	1	083108SV 7	Air Filter/Filter antipollen system heating/ventilation Service Contract	4	559		20284	km	0	00000000 0	29.03.2013
	08.03.2011 2				Small service - Regular reviews	3	8 559		20284	km			



Vehicle information (Database)

FIN: WDD [redacted] 202

Database:
FIN: WD [redacted] 202

Market: MBPL

VIN:
Date and room register: 20.06.2011

Registration No: WK3 [redacted]

Customer #:
Date of manufacture: 19.05.2011

Warranty Start: 20.06.2011

Model: E [redacted] IC

Seller:
Year of production: 2011

Last observed mileage: 115396 km

Radio Lot: B4 [redacted]

Location: normally

Unit:

Typ e	Unit No.	Des cription
01	65 [redacted] 542	Engine
02	722 [redacted] 707	Transmission

Vehicle info:

- The vehicle is provided with extended service. Every vehicle visit to the Authorized Service Station should be reported to the Mercedes-Benz Leasing [redacted] Service Center at telephone number (+4 [redacted] 88 from Monday to Friday from 8.00 to 18.00 and on Saturdays from 8.00 to 13.00.

Customer Address:

istoric-service.ro



FIN: WDD [redacted] 202

SA-codes:

Code	Text
A22	
A36	
A49	
A86	
A89	
B12	Tire-change toolkit
D0A	
D0C	
D0D	
FS	STATION WAGON
GA	AUTOMATIC TRANSMISSION
HA	REAR AXLE
J81	RELEASE JUNE
K10	Software control for the active light function
K11	Adaptive brake lights
K14	
L	L.H.D.
M22	CAPACITY 2.2 LITERS
Q35	Light Package
P54	Anti-Theft Protection package
R01	Summer tyres
R15	43.2 cm (17-inch) 10-twin-spoke light-alloy wheels
U01	Rear belt status indication in the instrument disp
German submarine U41	Fuel/water separator and lubrication package
German submarine U60	Active Bonnet
German submarine U72	DVD-PLAYER WITH REGIONAL-CODE 2 EUROPE, JAPAN
VL	FRONT AXLE HALF SHAFT, LEFT
VR	FRONT AXLE HALF SHAFT, RIGHT
V73	
03O	
051	AEJ 10/2
1U2	Snow guard for air conditioning air intake
108	black / alpaca gray ARTICO man-made leather
182	CONVERTER WITH DEV. CHARACTERISTIC
200	LEATHER
205	Literature in English
211	Direct control system

Vehicle information (SA-code)

 08

Code	Text
230	PARRONIC
240	LED daytime running lights
255B	
287	EASY-PACK quickfold
291	Pelvis
294	Kneebag
298	Rear Seat Safety package
401	Climatic front seats
413	Panoramic sliding sunroof electric, in glass
427	AMG SPEEDSHIFT MCT 7G-TRONIC
474	Diesel private filter
477	Tire pressure loss warning system
485	DIRECT CONTROL suspension comfortably
5XX	EUROPE
518	Media Interface
527	COMAND Online incl. DVD
55U	Roof liner beige fabric
551	Anti-theft alarm system
559	POLAND
580	THERMATIC automatic climate control
600	Headlamp cleaning system
608	Adaptive Highbeam Assist
619	Cornering light function
622	Intelligent Light System
682	Extinguisher
690	Collapsible spare wheel instead of TIREFIT tire se
700	
731	Trim elements brown burr walnut wood gloss
801	Technical modifications
81P	
840	Heat-insulating dark-tinted glass
882	Interior monitoring system
928	EU5 emission standard
955	ELEGANCE
963	Light clinging
966	COC document EU5 without registration certificate


RAPORT ISTORIC SERVICE AUTO COMPLET | 100% DETALIIAT | DIRECT DIN REPREZENTANTA
